

T09N-R01W-36\_0000\_MCS

SKIRVIN


2 ST. RD. #46

R/W 584' 37" 1/46'

DESCRIPTION:

A part of the Southeast quarter of the Southeast quarter in Section 36, Township 9 North, Range 11 West, Monroe County, Indiana, bounded and described as follows; Beginning at a point on the South line of said section 36 that is 987.00 feet West of the Southeast corner of said quarter quarter, thence running West over said section line for 209.43 feet and to the centerline of a county road, thence with the centerline of said county road the following courses and dimensions;

North 00 degrees 35 minutes East for 80.33 feet,  
North 12 degrees 49 minutes East for 55.00 feet,  
North 24 degrees 52 minutes East for 63.08 feet,  
North 30 degrees 48 minutes East for 214.39 feet,  
North 23 degrees 42 minutes East for 114.37 feet,  
North 02 degrees 16 minutes East for 229.18 feet and to the South right-of-way of State Road #46, thence leaving the centerline of said county road and running with the said South right-of-way South 84 degrees 37 minutes 46 seconds East for 19.28 feet, thence leaving said right-of-way and running South 01 degree 19 minutes 43 seconds West for 712.87 feet and to the point of beginning. Containing in all 1.71 acres more or less. Subject to a 25.00 foot right-of-way from the centerline of said county road.

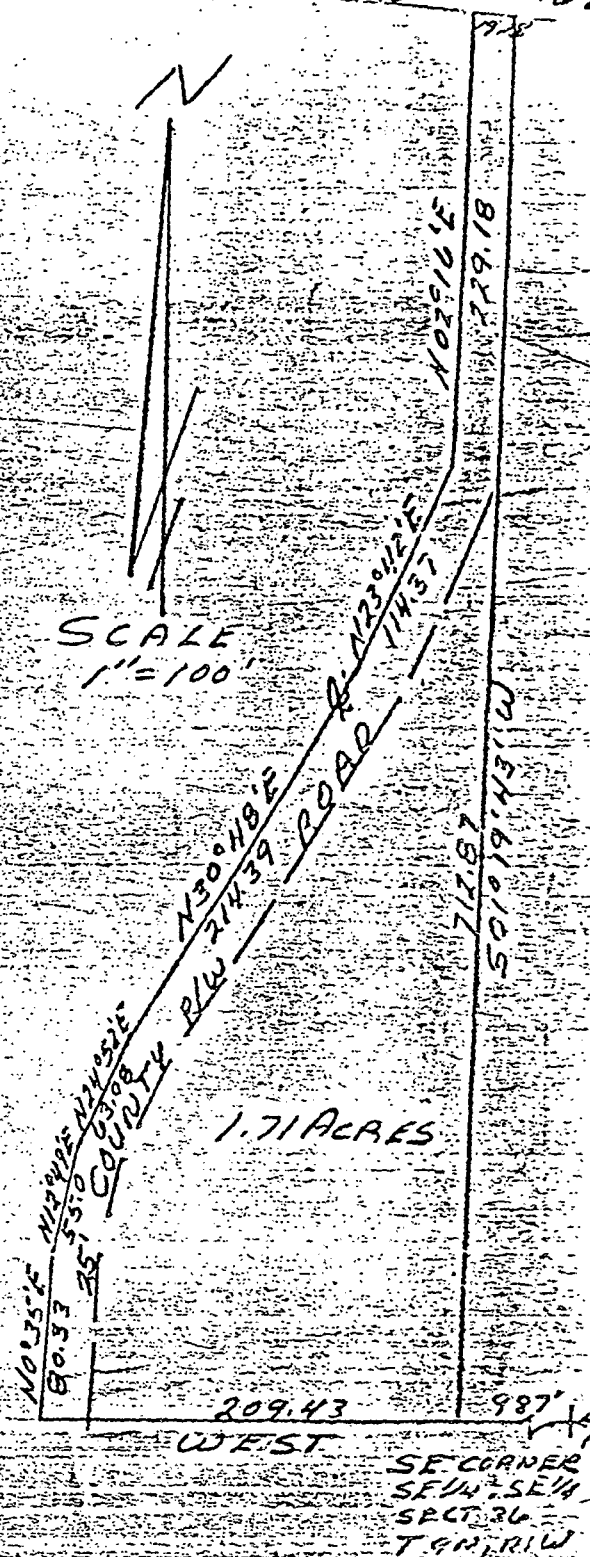

Raymond Graham

Raymond Graham  
P.E. 8409 Indiana  
3215 N. Smith Pike  
Bloomington, Indiana  
January 4, 1979



SE CORNER  
SE 1/4 SE 1/4  
SECT 36  
T 9 N, R 11 W

voluntary act and deed, for the uses and purposes herein mentioned, and Grantors. also swore to the truth of all statements made in this deed.

IN WITNESS WHEREOF, I have hereunto subscribed my name and affixed my official seal.

My commission expires:

April 26, 1980

Mary Frances Wilbur  
Mary Frances Wilbur Notary Public  
Residence: Monroe County, IN

DEED PREPARED BY: Thomas M. McDonald, Atty.

ROGERS, McDONALD & GRODNER  
P. O. Box 279  
Bloomington, Indiana 47401  
317 339 4421

*Survey description*  
*from Betty Buckard to*  
*Carson*  
*Blgtn*

RAYMOND GRAHAM

3215 N. SMITH PIKE  
BLOOMINGTON, INDIANA 47401


R.P.E. 3409 INDIANA

September 18, 1974


A part of the Southwest Quarter of the Northwest Quarter of Section Thirty-Six (36) and a part of the Northeast Quarter of Section Thirty-Five (35), all in Township Nine (9) North, Range One (1) West, in Monroe County, Indiana; Beginning at a point that is 2,843.34 feet North and 109.12 feet West of the Southwest corner of the said Section 36; said beginning point being the Northwest corner of the Howard Young 9 1/2 acre tract, and in the centerline of the Smith Road; thence running North 40 degrees West over and along the centerline of the Smith Road for 86 feet; thence running North 60 degrees West and continuing over and along the said centerline of the Smith Road for 100 feet, and to the Southwest corner of the Vickery Tract; thence leaving the centerline of the Smith road and running North 67 degrees East for 272 feet, more or less, and to the Southeast corner of the said Vickery Tract; thence running South 42 degrees- 30 Minutes East for 170 feet; thence running North 64 degrees-45 Minutes East for 120 feet; thence running North 80 degrees-45 Minutes East for 126 feet; thence running South 71 degrees-12 Minutes West for 245.5 feet; thence running South 63 degrees-12 Minutes West for 235.5 feet, and to the place of beginning, Containing in all One (1) acre, more or less.

Subject to all legal highways and easements of record.

*Raymond Graham*


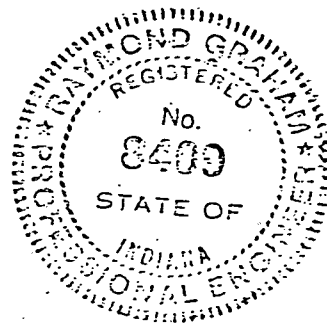


*Blgtn*

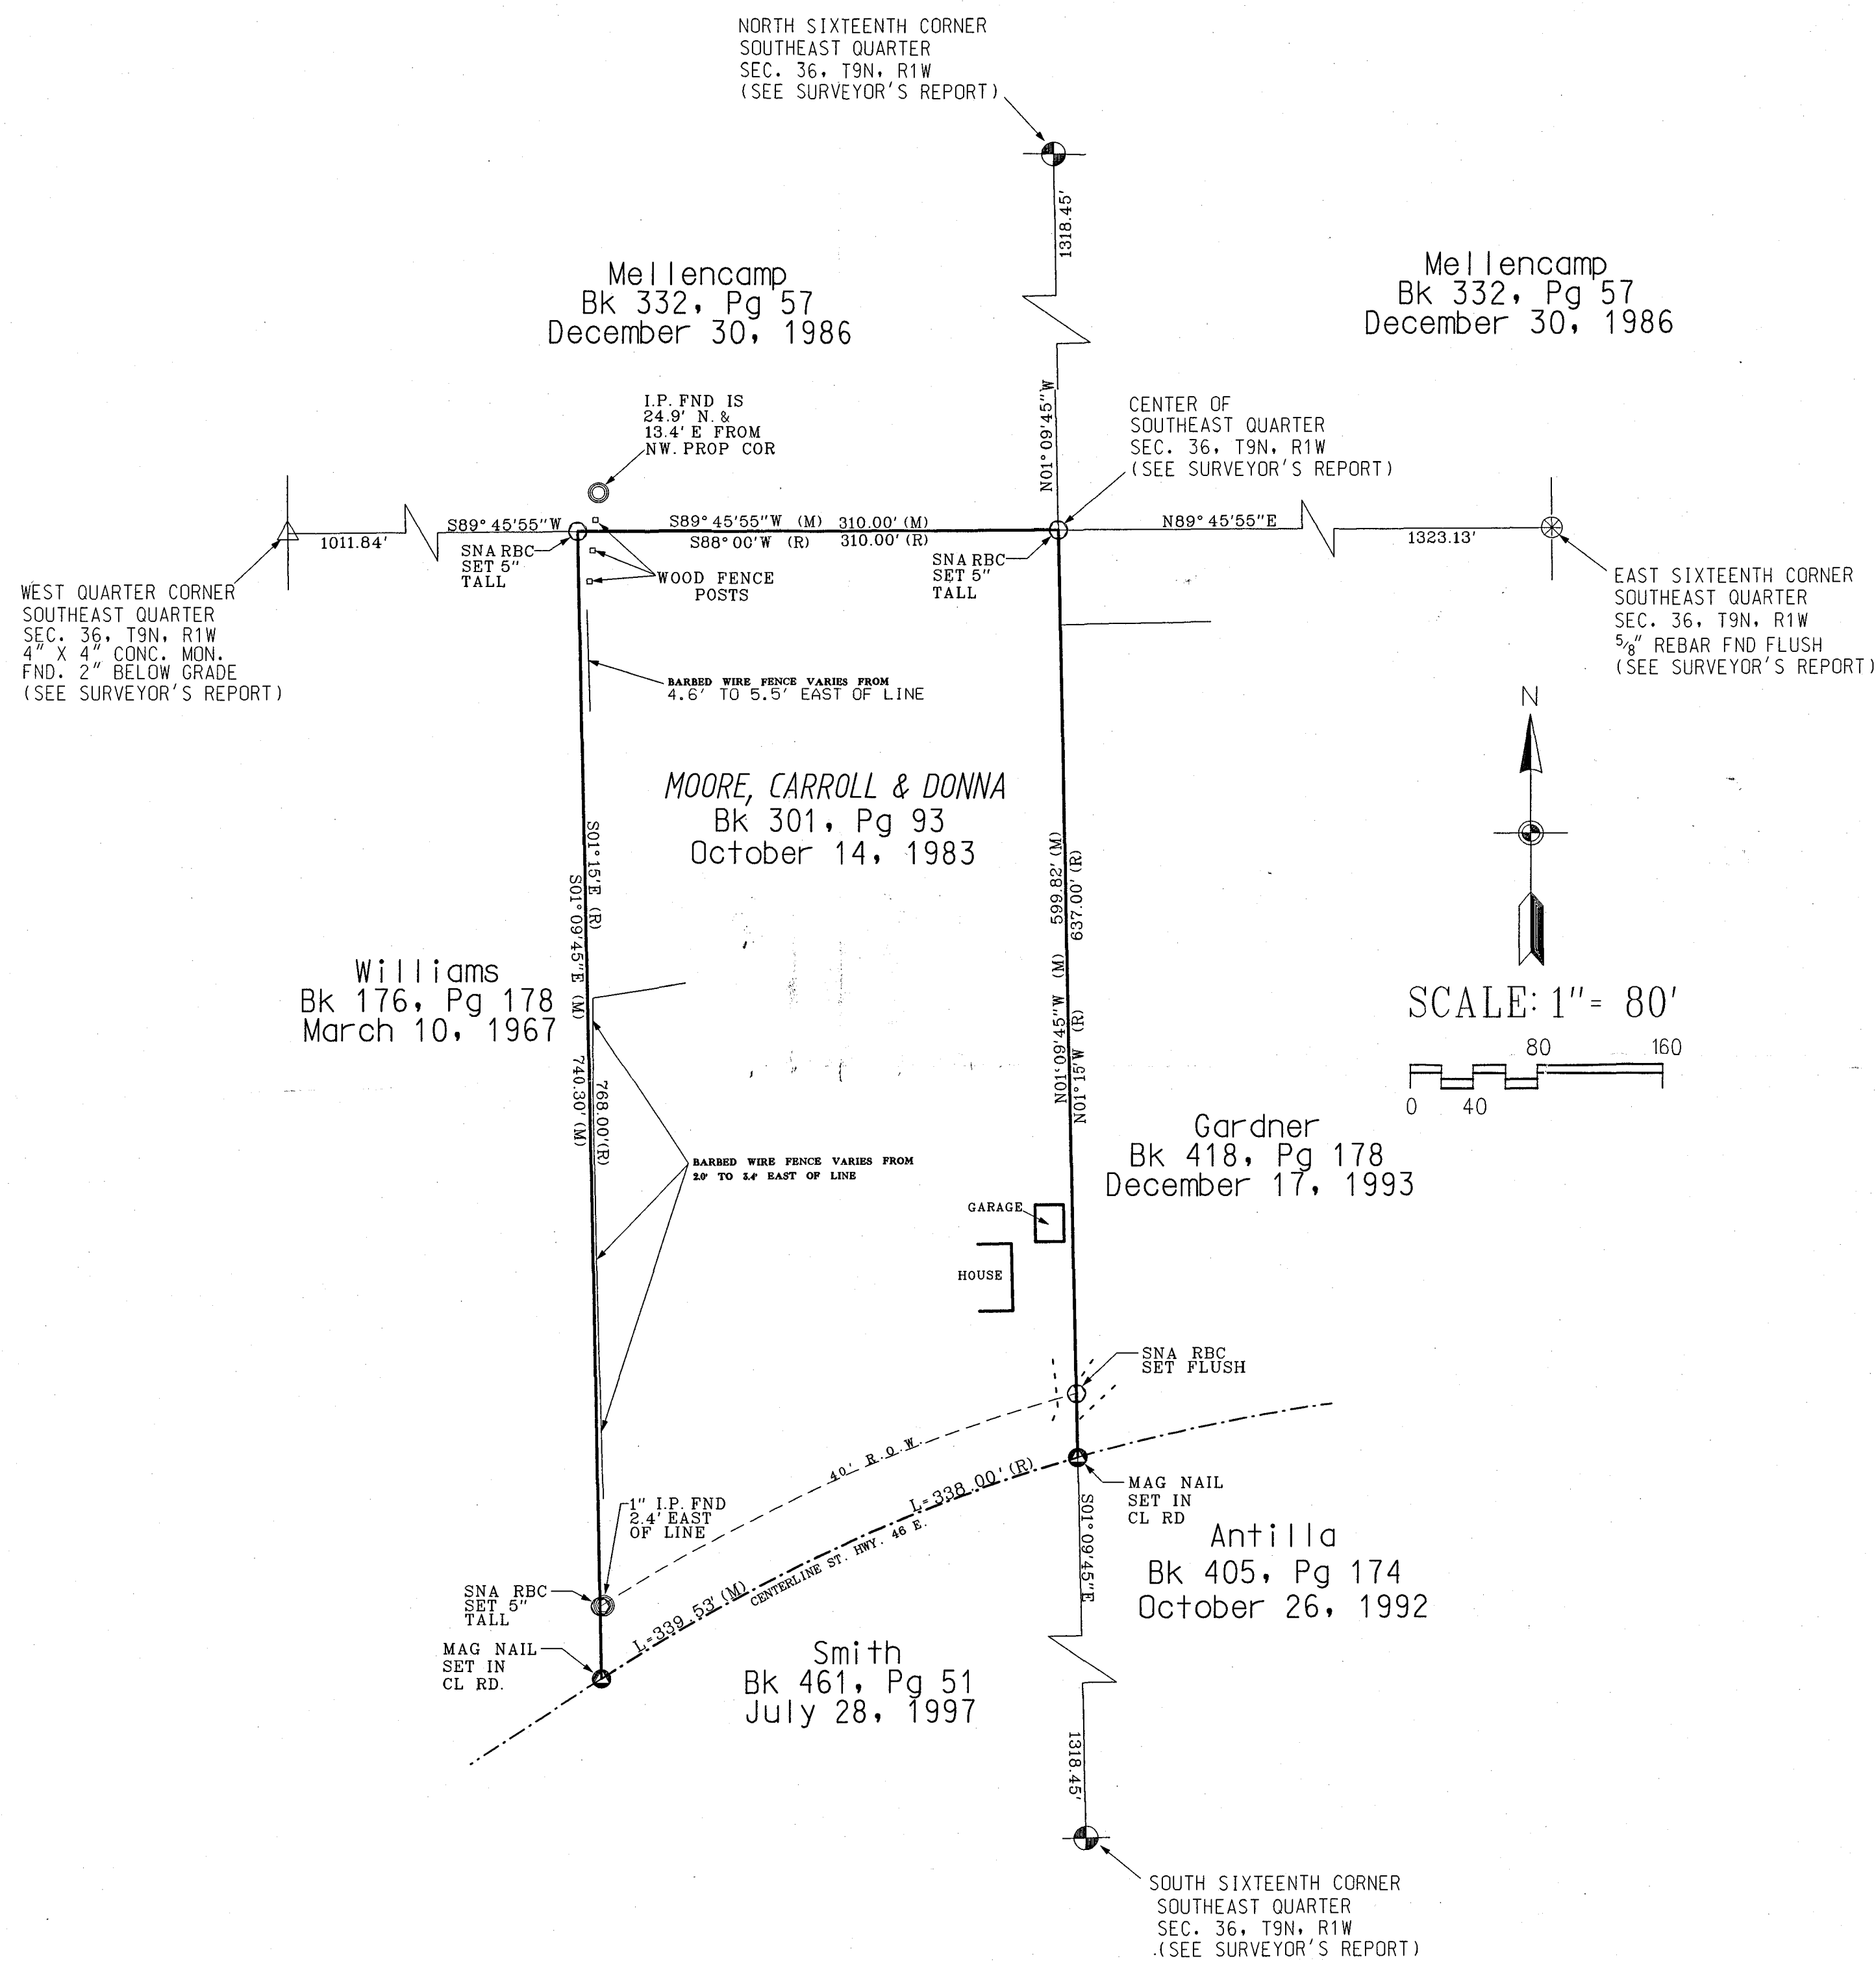

NOTES:  
1) Fieldwork for this survey was completed November 2005.  
2) Bearings and Distances with (R) are from record Description, those with (M) were measured this survey.  
3) Basis of Bearings is Assumed

MONUMENT LEGEND  
STONE MONUMENT  
STONE WITH X  
CONCRETE MONUMENT  
5/8" REBAR W/PLASTIC CAP SET  
REBAR FOUND  
RON PIPE FOUND  
FENCE POST FOUND  
RAILROAD SPIKE  
PK / MAG NAIL  
GPS MONUMENT  
SECTION CORNER  
CALCULATED CORNER

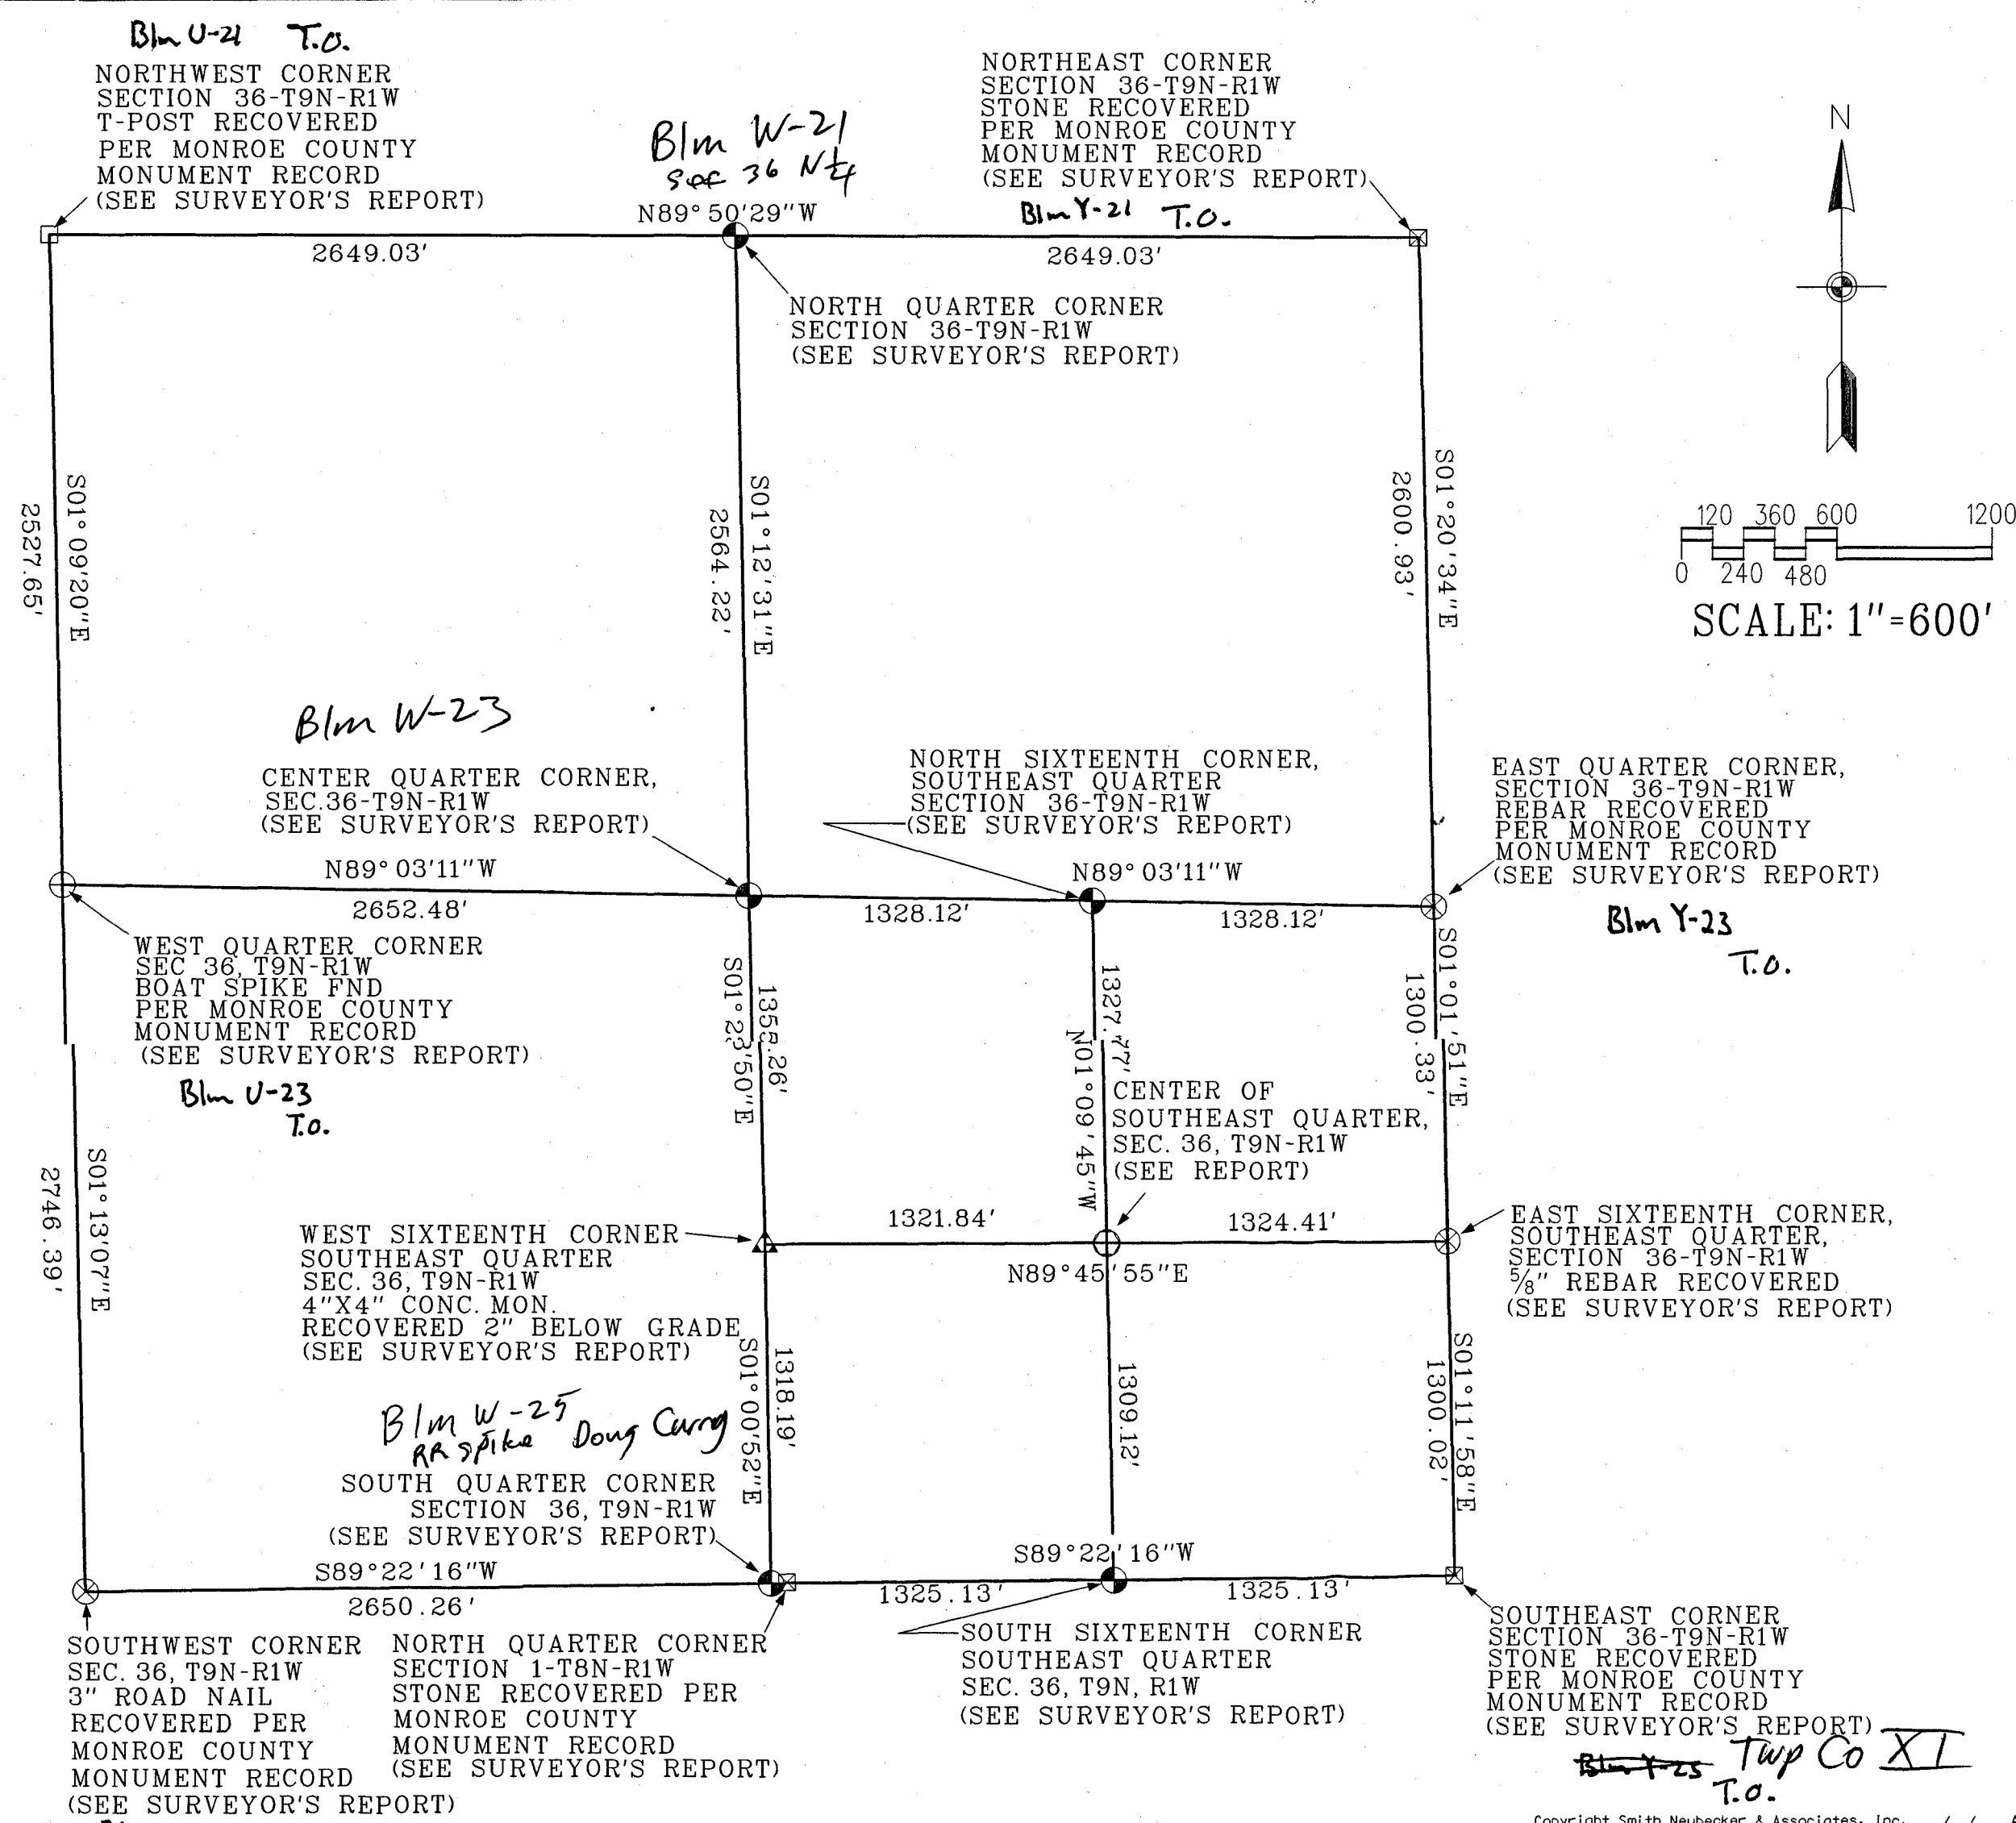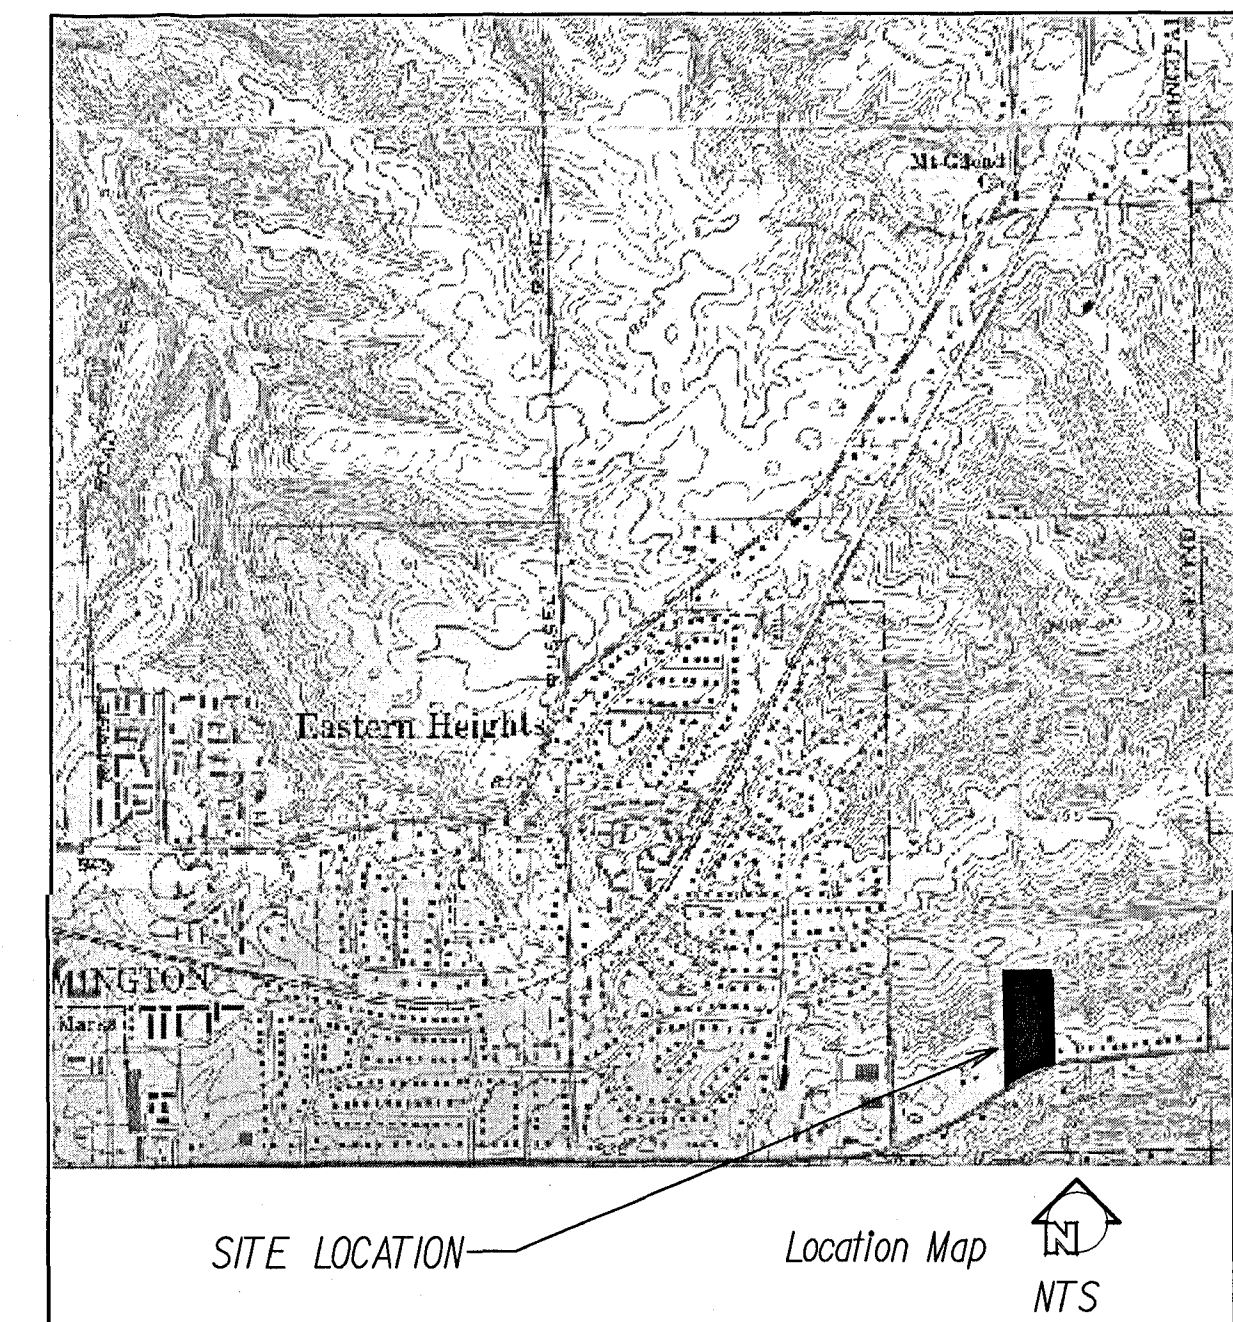

SMITH NEUBECKER & ASSOCIATES, INC.  
453 S. CLARK ST. SUITE 200  
BLOOMINGTON, IN 47404-4707  
TELEPHONE: (317) 336-6536  
FAX: (317) 336-6537  
WWW.SNAINC.COM

JOB TITLE  
CARROLL & DONNA MOORE  
BOUNDARY SURVEY  
SEC. 36, T9N, R1W, SE 1/4

| REVISIONS | BY | DATE |
|-----------|----|------|
|           |    |      |
|           |    |      |
|           |    |      |
|           |    |      |
|           |    |      |

SURVEYED  
C.M. A.W.  
KMB  
DRN  
11/15/05

SHEET  
4007  
1  
OF  
2  
DATE 12/01/05  
BOUNDARY SURVEY



RECORD LEGAL DESCRIPTION:

A part of the east half of the southwest quarter of the southeast quarter of Section Thirty-six (36), Township Nine (9) North, Range One (1) West in Monroe County, Indiana, bounded and described as follows: Beginning at the northeast corner of the southwest quarter of the southeast quarter of Section Thirty-six (36), Township Nine (9) North, Range One (1) West, thence south Eighty-eight (88) degrees 00 minutes west, three hundred ten (310) feet to a point, thence south One (1) degree Fifteen (15) minutes east, and with an angle of Ninety (90) degrees Fifty (50) minutes, Seven Hundred Sixty-eight (768) feet to the center of State Road #46, thence east on and along said center line three hundred thirty-eight (338) feet to a point; thence north One (1) degree Fifteen (15) minutes west and with an angle of one hundred and nine (109) degrees twenty-five (25) minutes, six hundred thirty-seven (637) feet to the point of beginning, containing in all five (5) acres, more or less.

MODERNIZED LEGAL DESCRIPTION:

A part of the southwest quarter of the southeast quarter of Section Thirty-six (36), Township Nine (9) North, Range One (1) West, Bloomington Township, Monroe County, Indiana, being the Carroll W. Moore and Donna L. Moore property as described in Book 301, Page 93 in the Monroe County Recorder's Office, and being depicted on a plat of survey by Smith Neubecker & Associates, Job No. 4007, being more completely described as follows, to wit:

Beginning at the center of the southeast quarter of Section 36-9N-1W, being marked by a 5/8-inch rebar, with a plastic cap marked SNA, INC. LS29500020, hereinafter described as a Smith Neubecker capped rebar, thence along the north line of said quarter-quarter section, South 89° 45' 55" West, 310.00 feet to a Smith Neubecker capped rebar, thence parallel to the east line of said quarter-quarter section, South 01° 09' 45" East, 740.30 feet to the centerline of State Road 46, said point marked by a Mag nail; thence along the centerline of State Road 46, being a non-tangent curve to the right (said curve being concave southeasterly, having a radius of 1136.67 feet and a chord bearing North 65° 13' 50" East, 338.27 feet) an arc distance of 339.53 feet to the east line of said quarter-quarter section, said point marked by a Mag nail; thence along the east line of said quarter-quarter section, North 01° 09' 45" West, 599.82 feet to the point of beginning, containing 4.70 acres.

SUBJECT TO ALL EASEMENTS, RESTRICTIONS, AND RIGHTS-OF-WAY OF RECORD

SURVEYOR'S REPORT

The record descriptions used in this survey were provided by research at the office of the Monroe County Auditor and Recorder. The purpose of this survey is to retrace the boundary of the Carroll and Donna Moore property, as described in book number 43, page 20 in the office of the Recorder of Monroe County. The subject property lies in the East Half of the Southwest Quarter of the Southeast Quarter of Section 36, Township 9 North, Range 1 West, Bloomington Township, Monroe County, Indiana. Survey data shown hereon is based upon an assumed coordinate system.

There may be differences with deed dimensions when compared with measured dimensions along the boundary lines shown hereon. In cases where the magnitude of these differences is less than the Theoretical Uncertainty stated in the following report and less than the uncertainty identified for the reference monumentation discussed in the following report, the differences may be considered insignificant and are shown only for the purposes of mathematical closure and are therefore not discussed below. When such differences are greater than said uncertainties or are the result of title discrepancies, they are generally discussed in more detail below as may be necessary for clarity of the lines established or reestablished this survey.

Unless otherwise noted on the attached plat or in the following report, there is no evidence of occupation along the boundary lines of the subject tract. When fences or other lines of occupation are shown on the plat, they have been located only at the ends or specific locations noted; therefore, for the purposes of this survey, such lines are assumed to run straight between said locations, but in actuality may slightly vary from such straight line.

SURVEY DATA UTILIZED FROM THE FOLLOWING SOURCES:

Copies of the surveys, plats, and information referenced either below or on the attached plat, were obtained from files and information at the following offices:

Monroe County Surveyor's Office: Monument Record Sheets, Original Government Field Notes, and recorded surveys in the area of interest.

Monroe County Auditor's Office: Surveys and subdivision plat files

Monroe County Recorder's Office: Recorded surveys and subdivision plats

Smith Neubecker and Associates, Inc.: Surveys and subdivision plats on file.

Copies of other private surveys were obtained if they were referred to on other surveys obtained from the above offices or were known to exist and could be located for copying purposes.

- I. Boundary survey of the Kerr Creek LLC property by Smith Neubecker & Associates, Job No. 2373, dated July 17, 1998.
- II. Boundary survey of the Thornton Oil Corporation property by Douglas R. Curry, Drawing No. 5099103, Recorded August 25, 1999 in the office of the Monroe County Recorder as Document No. 1999017265.
- III. Boundary survey of the Edington property by Bynum Fanyo & Associates, Inc., Drawing No. 409742, Recorded August 2, 1997 in the office of the Monroe County Recorder.
- IV. Boundary survey of the Pingleton Sawmill property by Douglas R. Curry, Recorded February 15, 1995 in Book 3, Pages 325-328 in the office of the Monroe County Recorder.
- V. Boundary Survey of the Thornton Oil Company property by Smith Quillman Associates, Inc., Job No. 1519, Recorded June 28, 1980 in the office of the Monroe County Recorder.
- VI. Boundary Survey of the Eastside Investment/Henry West property by Lee Utt, dated March 17, 1986.

1) Variance caused by the availability and condition of record monuments;

A) Original Government Corners

The northeast corner of Section 36-9-1W is marked by a 5 inch x 5 inch stone with 6 inches of the stone being exposed above grade. Said stone is referenced on the Monument Record sheet in the Monroe County Surveyor's office, and is depicted on a plat of survey by Douglas R. Curry dated May 25, 1994, hereinafter referred to as 1994 Curry survey (and revised survey dated February 13, 1995, hereinafter referred to as 1995 Curry survey). There is little or no uncertainty associated with this corner.

The east quarter corner of Section 36-9-1W is marked by a Douglas R. Curry capped rebar recovered 3 inches above grade. No Monument Record sheet for this corner was found in the Monroe County Surveyor's office. Said rebar is depicted on a plat of survey by Stephen L. Smith dated July 17, 1998, hereinafter referred to 1998 Smith survey, plat 1994 Curry survey, plat 1995 Curry survey). Based on the Curry surveys, said monument appears to have been set at a midpoint split between the northeast and southeast corners of Section 36. The calculated midpoint split between the northeast and southeast corners based upon the fieldwork completed for the current survey indicates that the recovered rebar falls 5.17 feet east and 0.18 feet south of the computed position; therefore some uncertainty exists regarding this corner.

The southeast corner of Section 36-9-1W (township corner) is marked by a stone. Said stone is referenced on the Monument Record sheet in the Monroe County Surveyor's office, and is depicted on a 1994 Curry survey (and the 1995 Curry survey), a plat of survey by Douglas R. Curry dated August 6, 1999, hereinafter referred to as a 1999 Curry survey, and is referenced on a plat of survey by Ben E. Bledsoe dated February 26, 1990, hereinafter referred to as 1990 Bledsoe survey. There is little or no uncertainty associated with this corner.

The south quarter corner of Section 36-9-1W is calculated at the midpoint split between the southeast and southwest corners of Section 36. No monument was set marking this corner during this survey. No Monument Record sheet for this corner was found in the Monroe County Surveyor's office. The north quarter corner of Section 1, Township 8 North, Range 1 West is marked by a stone, which is referenced on the Monument Record sheet in the Monroe County Surveyor's office. Said stone was recovered during this survey and falls 3.41 feet north of the section line and 61.65 feet east of the calculated midpoint split. The location of this stone has no bearing on the location of the south line of section 36; therefore, its location was not used during the course of this survey. A railroad spike is shown being set at the south quarter corner on the 1999 Curry survey at a distance of 61.37 feet west of the stone marking the north quarter corner of Section 1 in the township immediately to the south. A search was made to recover the railroad spike, but it appears that road work at the intersection of State Roads 46 and 446 has destroyed this monument. The 1990 Bledsoe survey indicates that a stone was found at the south quarter corner, but it is my opinion that the stone depicted on said survey is actually the one marking the North quarter corner of Section 1 in the township immediately to the south. There is little or no uncertainty associated with this corner.

The southwest corner of Section 36-9-1W is marked by a 3 inch road nail. Said nail is reference on the Monument Record sheet in the Monroe County Surveyor's office. A plat of survey by Richard E. Waltrip dated July 31, 1997 indicates that a brass disk was found marking this corner, but it is labeled as the south quarter corner of the subject section, apparently by mistake. The Monument Record sheet indicates that a brass disk was set to mark this corner at one time, but a note on the sheet indicates that the brass disk was never set per Don Stanger dated 11/4/1997, who was working for the Indiana State Highway Survey Location Team at the time the note was made. There is little or no uncertainty associated with this corner.

The west quarter corner of Section 36-9-1W is marked by a boat spike. Said boat spike is reference on the Monument Record sheet in the Monroe County Surveyor's office. A plat of survey by Lee Utt dated March 17, 1986 indicates that an I.P. (iron pipe?) was set marking this corner, but this monument was not recovered during this survey. There is little or no uncertainty associated with this corner.

The northwest corner of Section 36-9-1W is marked by a T-post found 0.8 feet below grade. The Monument Record sheet in the Monroe County Surveyor's office indicates that a 1 inch angle iron is marking this corner. Existing ties shown on the Monument Record sheet were found to the east and southeast, and were used to determine a search area. The T-post was recovered and agreed with the two ties mentioned above. The western tie (X on northern most guardrail post) indicated on the Monument Record sheet was apparently destroyed during construction for the widening/improvement of Russell Road. Although the monument type referenced on the Monument Record sheet differs from what was recovered in the field, based upon the ties as supporting evidence, it is my opinion that there is little or no uncertainty associated with this corner.

The north quarter corner of Section 36-9-1W is calculated at the midpoint split between the northwest and northeast corners of Section 36. No monument was set marking this corner during this survey. No Monument Record sheet for this corner was found in the Monroe County Surveyor's office. A diligent search was made to locate evidence in the field in the vicinity of the corner, but the steep terrain and dense growth in this area made it difficult to locate any useful evidence. No surveys of record were found depicting this corner since it was originally established in September of 1815. There is little or no uncertainty associated with this corner.

B.) Other Corners

The center of Section 36 is established at the intersection of lines connecting opposite quarter corners. No information of record was found to indicate that this corner had been set in the past. No monument was set marking this corner during this survey.

The north sixteenth corner of the southeast quarter of Section 36 is calculated at the midpoint split between the center and east quarter corner of Section 36. No monument was set marking this corner during this survey.

The east sixteenth corner of the southeast quarter of Section 36 is marked by a 5/8" rebar that was recovered. The rebar appears to have been set during the 1994 Curry survey at a midpoint split between the southeast and east quarter corners of Section 36. Said rebar is also depicted on the 1998 Smith survey and has apparently been accepted as the position of this corner.

The south sixteenth corner of the southeast quarter of Section 36 is calculated at the midpoint split between the southeast and south quarter corners of Section 36. No monument was set marking this corner during this survey.

The west sixteenth corner of the southeast quarter of Section 36 is marked by a 4 inch x 4 inch concrete monument that was recovered 2 inches below grade. Said monument appears to be a local sixteenth corner, with its origin being unknown, and is depicted on the 1994 Curry Survey (and the 1995 Curry Survey), and the 1999 Curry Survey.

The center of the southeast quarter of Section 36 was established at the intersection of lines connecting opposite sixteenh corners within the southeast quarter of Section 36. A 5/8-inch rebar, with a plastic cap marked SNA, INC. LS29500020 was set at this corner during this survey.

C.) Other Monumentation

A 1-inch pipe was found 12-inches above grade and 13.4 feet east and 24.9 feet north of the northwest corner of the subject property in an old east-west fence line. No information of record was found regarding this monument; therefore, it was not used during the course of this survey.

A 1-inch pipe was found 2.4 feet east and 47.4 feet north of the southwest corner of the subject property. No information of record was found regarding this monument; therefore, it was not used during the course of this survey.

2) The existing deeds and plats of record;

The north line of the subject property was held as the north line of the southwest quarter of the southeast quarter of Section 36. No controlling call for this quarter-quarter line was found in the subject deed, but it is my opinion that this was the intent of the original subdivider. The description for the adjoiner to the north, Mellencamp, is an aliquot part description, which is bounded to the northwest quarter of the southeast quarter of the subject section.

The west line of the subject property was held as being parallel with the east line of the southwest quarter of the southeast quarter of the subject section. The subject deed does not specifically call for it to be parallel, but the bearings of the east and west lines match; therefore, parallelism appears to have been the intent of the original subdivider. A discrepancy was found in the subject deed between the bearings of the north and west lines of the subject property. An angle of 90° 50' is indicated in the subject deed, but the bearings from the subject deed create an angle of 90° 45'. The description for the adjoiner to the west contains a commencing call that matches the first call in the subject deed, with the final call in the adjoiner's deed also matching the second call of the subject deed. The length of the west line (740.30 feet) differs significantly from the deed distance (768 feet) which creates some uncertainty as to the location of the north line of the quarter-quarter section.

The south line of the subject property was held along the physical centerline of State Road 46, based upon the controlling call contained in the subject deed. No documents of record were found regarding possible right-of-way along State Road 46. Other nearby surveys depict a 40-foot half width right-of-way for State Road 46. Capped rebars were set along the east and west property lines at a distance of 40.00 feet from the centerline of State Road 46. The description for the adjoiner to the south, Smith, calls for the center of State Road 46 as the northern boundary.

The east line of the subject property was held as the east line of the southwest quarter of the southeast quarter of the subject section. No controlling call for this quarter-quarter line was found in the subject deed, but it is my opinion that this was the intent of the original subdivider. The description for the east adjoiner, Gardner, calls for the quarter-quarter line. Also, the description for the east adjoiner, Mellencamp, is an aliquot part description, which is bounded to the southeast quarter of the southeast quarter of the subject section. The length of the west line (599.82 feet) differs significantly from the deed distance (637 feet) which again creates some uncertainty as to the location of the north line of the quarter-quarter section.

3) The occupation or possession lines (fences, etc.) as related to the surveyed lines;

An old fence and tree row were found along the western side of the subject property. The fence varies from 2.0 feet to 5.5 feet east of the subject property line. Two 4-inch wood posts were found near the northern end of the west line. These posts vary from 4.6 feet to 5.5 feet east of the subject property line.

A common driveway for the subject property and the adjoiner to the east was found to be located along the east line of the subject property near State Road 46.

4) The theoretical uncertainty of measurements;

A) The theoretical uncertainty of position of the lines and corners of this survey due to measurements is within the specifications for a Class C Retracement Survey (0.50 feet).

NOTES

1) Every document of record reviewed and considered as a part of this survey is noted hereon. Other documents may exist that would affect this parcel.

2) This survey does not constitute a title search by the Surveyor.

LAND SURVEYOR'S CERTIFICATE



The undersigned, a Registered Land Surveyor of the State of Indiana does hereby certify that the attached plat and above legal description were prepared under his direct supervision, and to the best of his knowledge and belief was executed in accordance with the requirements of the Indiana Survey Standards as defined in Title 865, Article 1, Rule 12 of the Indiana Administrative Code.

CERTIFIED BY: Darren R. Norrington DATE: 12-02-2005  
Darren R. Norrington, ILS # 20500008

FIELD WORK COMPLETION DATE: November 16, 2005

PREPARED FOR: Carroll and Donna Moore  
2646 Windermere Woods Drive  
Bloomington, IN 47408

TITLE HOLDER: Carroll and Donna Moore

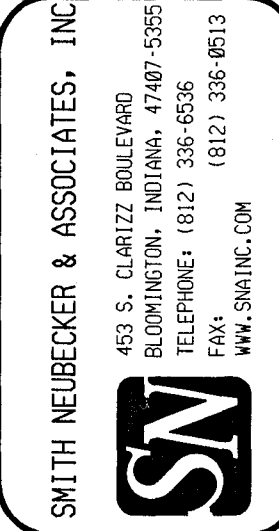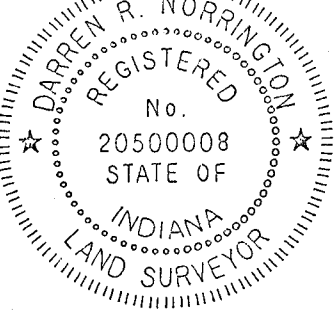

JOB TITLE  
**CARROLL & DONNA MOORE**  
BOUNDARY SURVEY  
SEC. 36, T9N, R1W, SE 1/4

| REVISIONS | BY | DATE |
|-----------|----|------|
|           |    |      |
|           |    |      |
|           |    |      |
|           |    |      |
|           |    |      |
|           |    |      |
|           |    |      |
|           |    |      |
|           |    |      |

|                         |     |     |                  |
|-------------------------|-----|-----|------------------|
| SURVEYED<br>C.M.A.A. W. | KMB | DRN | DATE<br>11/16/05 |
|-------------------------|-----|-----|------------------|


JOB NUMBER  
**4007**

SHEET  
**2**  
OF  
**2**

DATE  
**12/01/05**

BOUNDARY SURVEY



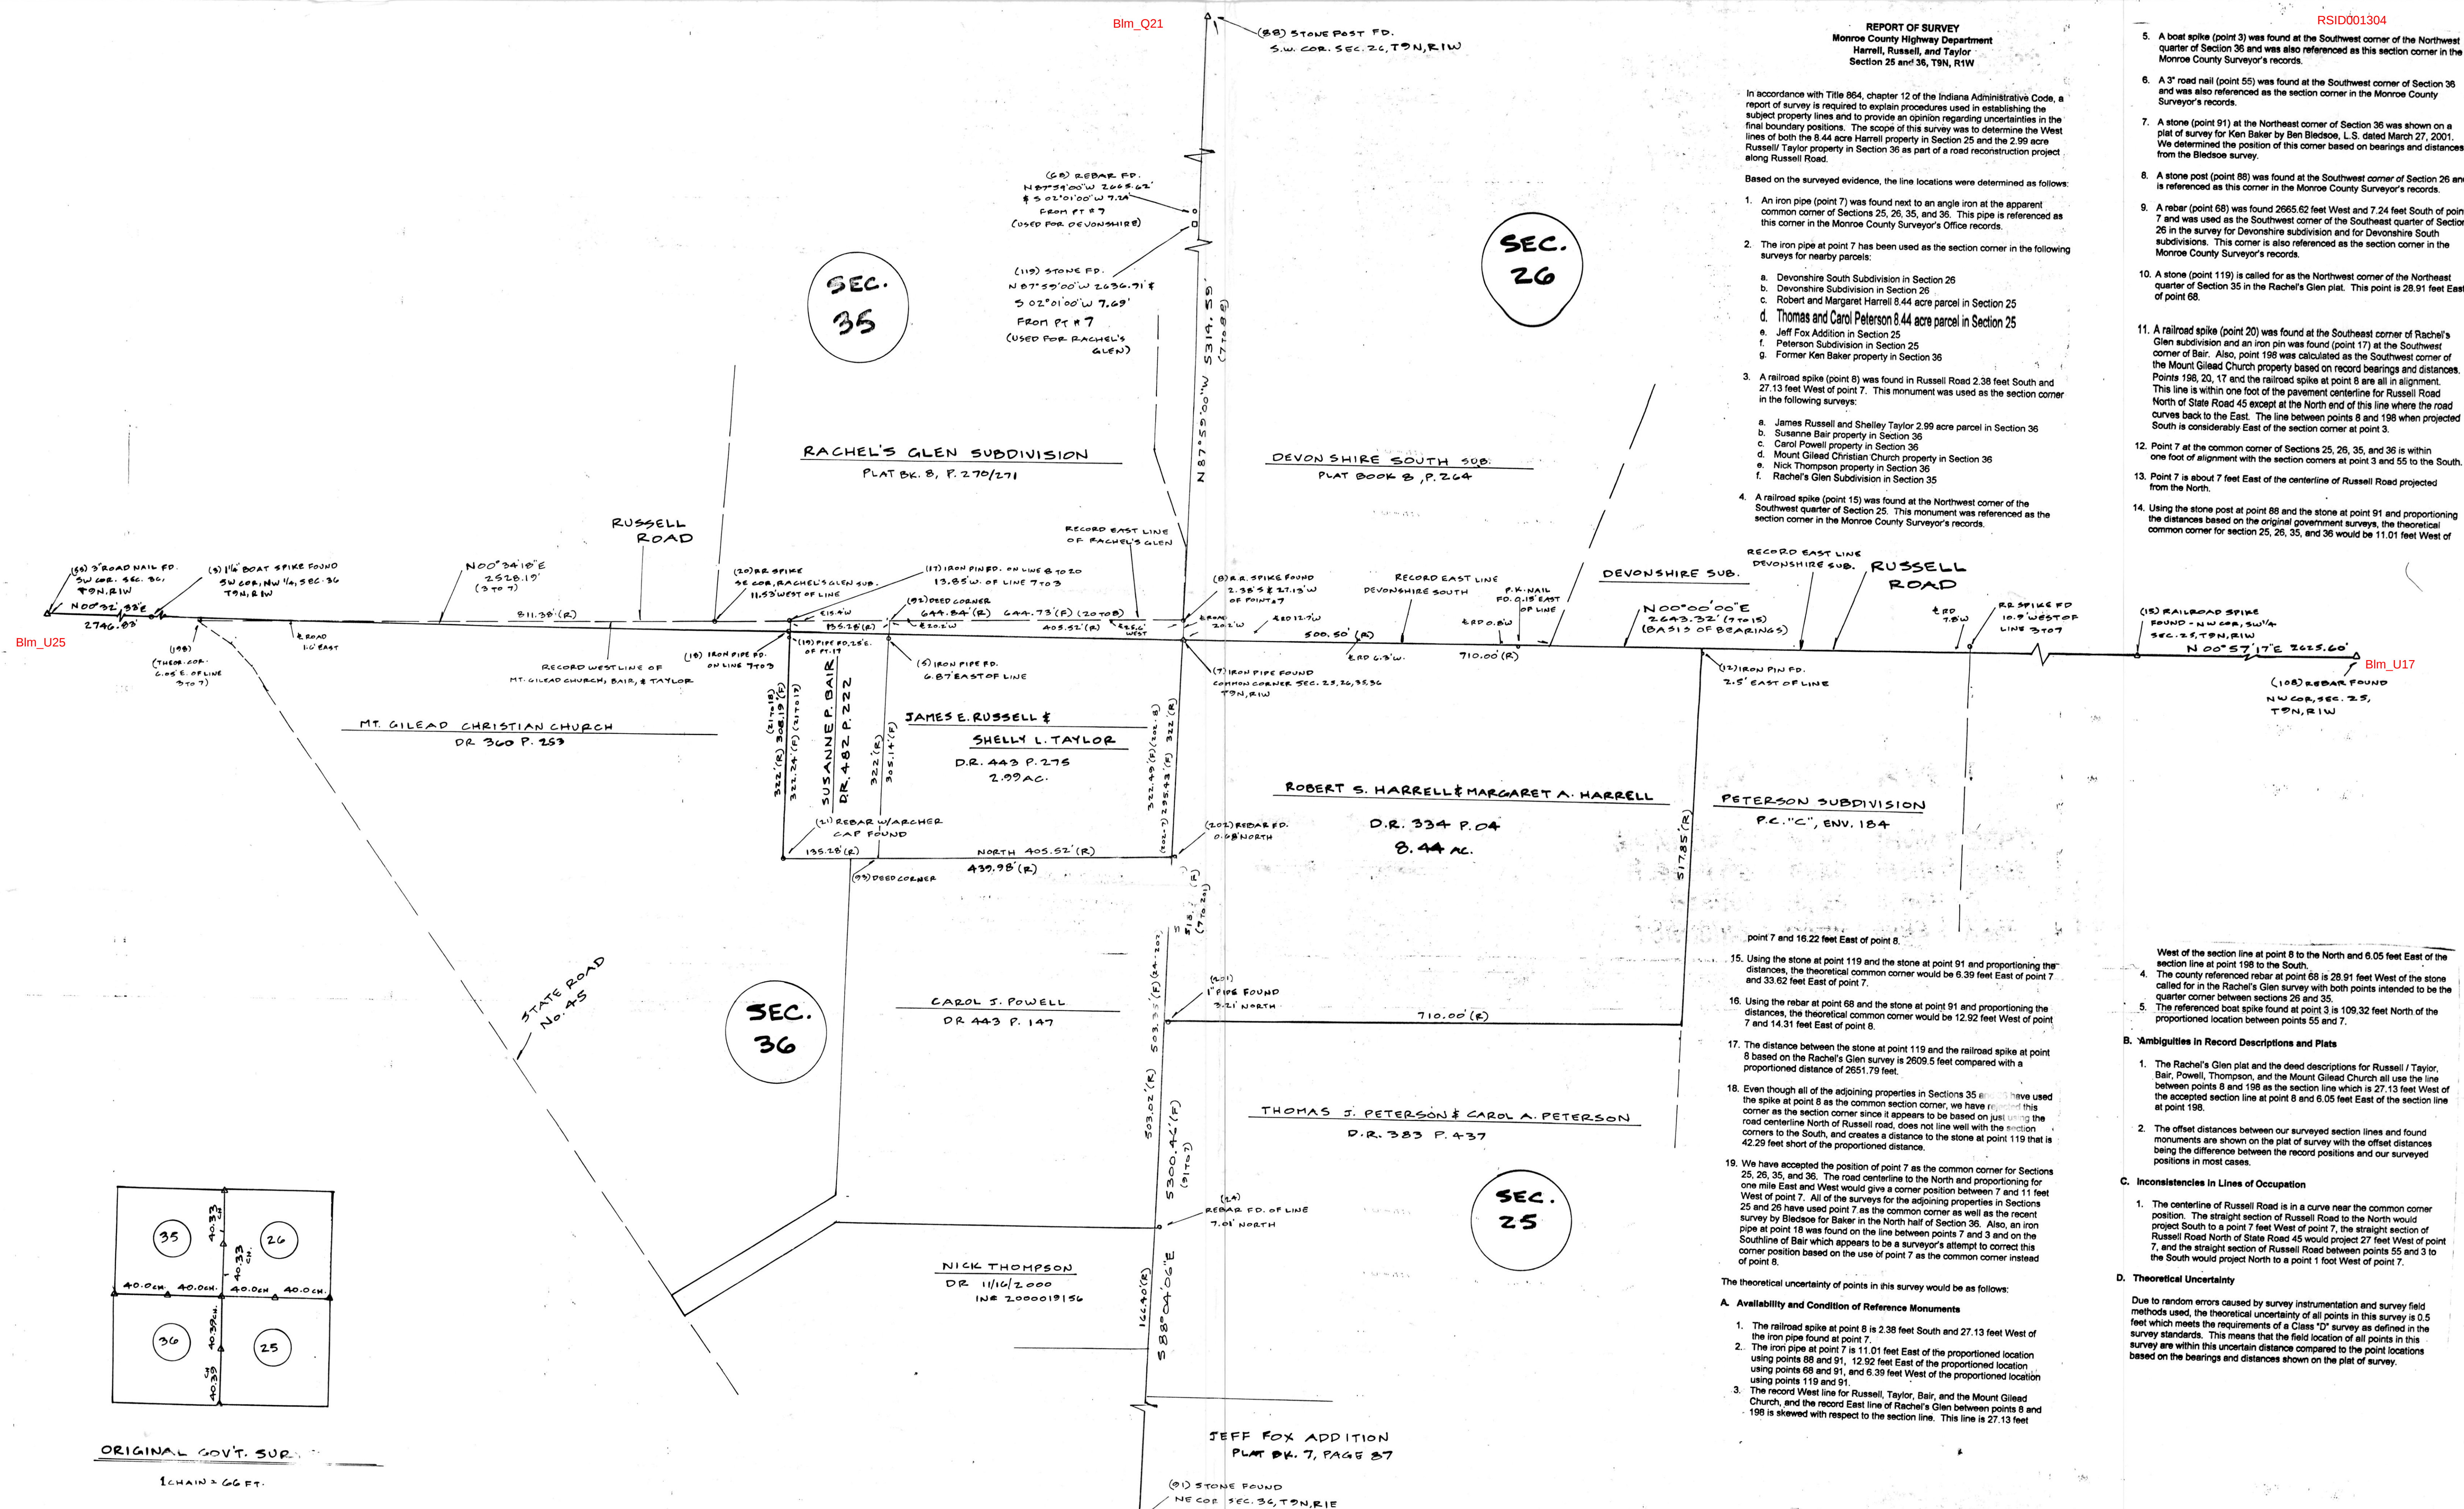


# **PLAT of SURVEY**

for  
**MONROE COUNTY HIGHWAY DEPT.**  
**Russell Road Realignment Project**  
**Sections 25, 26, 35, and 36**  
**Township 9 North, Range 1 West**

*Kevin B. Potter* 11/14/201  
**Kevin B. Potter, P.E. & L.S.**  
**621 North College Avenue**  
**Bloomington, Indiana 47404**  
**Phone (812) 331-7981**



(91) COORDINATE REFERENCE NUMBER  
 (F) BASED ON FIELD MEASUREMENTS THIS SURVEY  
 (R) BASED ON DEED RECORD

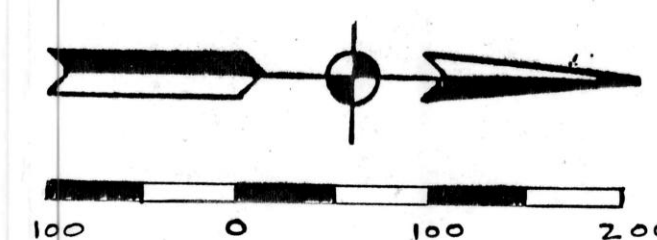



April 8<sup>th</sup> 1852

Surveyed for 6 Tralls John Sullivan  
 & John Martin in Section No 25 T10 R1 Tr 4 established  
 the following corners Cor A is N E cor of 1/2 of A E gr  
 witness Hickory 20 in diam S 24° E 42 lbs dist oak 30 in  
 diam N 68° E 22 lbs dist



Cor B S E cor of 1/2 of A E gr witness Buck 18 in  
 diam N 77 1/2° E 26 links dist Buck 8 in diam N 33° E 33  
 lbs dist


Cor C S E cor of 1/2 of A E gr of S E gr witness Buck 12 in  
 diam N 45° E 23 lbs dist Buck 10 in diam N 72° E 42 lbs  
 dist

Cor D center of the section witness Burr Oak 24 in dia  
 S 23° E 41 lbs dist Hickory 8 in diam S 72° E 22 links distant  
 Noah Payne & Jo Payne chain bearers  
 Countrod Malls & John Sullivan Sworn

James Goodborn N. C. S.

April 17 & 18

Surveyed for Samuel Latimore & others  
 in Section 36 T9 R1 met & established the following  
 corners Cor A the N E cor of South half of S E gr  
 witness Blue Ash 24 in diam N 12° E 25 1/2 lbs dist Buck

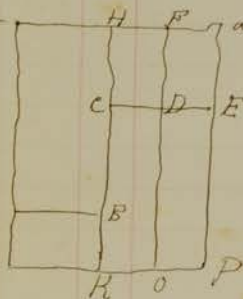

20 in diam S 40° E 39 lbs dist

Cor B N E cor of 1/2 of S E gr witness 13 Walnut 16  
 in diam N 75° E 36 lbs dist Buck 20 in diam S 35° E  
 76 lbs dist

Cor C S E cor of 1/2 of A E gr  
 witness 7 in diam S 22 1/2° E 10 lbs dist  
 Poplar 8 in diam N 14° E 33 lbs dist

Cor D A E cor of S E gr of A E gr witness 16  
 Elm 16 in diam N 81° E 5 lbs dist Elm 7 in diam

N 12° E 3 1/2 lbs dist Cor E S E cor of A E gr of A E gr  
 witness 14 in diam west 52 lbs dist Buck 10 in dia

Cor F N E cor of A E gr of A E gr witness 10 in dia  
 S 82 1/2° E 6 1/2 lbs dist 7 in diam N 19° E 18 1/2 lbs dist

North 1/2 mile witness Sycamore 6 in diam S 34° E 55 lbs dist  
 Buck 18 in diam S 51 1/2° E 181 lbs dist

length from a to b 3 22/100 poles over mile b to c 10 feet under mile  
 North half mile 32 ft over H H 18 ft under a m 9 over 1/2  
 mile

James Allen & John Rock  
 Chain Bearers Sworn

James Goodborn N. C. S.



May 26<sup>th</sup> A D. 1853

Ran the following lot of land in Section No thirty six (36) Township No nine north of Range one West, being a part of the East half of the north east quarter of said Section and bounded as follows to wit: Commencing at the Northern  $\frac{1}{2}$  mile post of said section  
 X Thence S  $84\frac{1}{2}^{\circ}$  W 82 Poles  $6\frac{1}{2}$  links to a stake then S  $3^{\circ}$  E 40 Poles  $20\frac{1}{2}$  lks to a stake Thence N  $84\frac{1}{2}^{\circ}$  E 82 Poles  $6\frac{1}{2}$  links to a stake Thence N  $3^{\circ}$  W 40 Poles  $20\frac{1}{2}$  lks to the beginning containing 20 Acres 3 R and 37 Poles

James W. Spencer  
 Monroe County Surveyor

The above was done for Joseph Dearmin & Philip Rogers

August the 15<sup>th</sup> 1863

Ran the following lines in Section No 22 Township No (9) nine north of Range No one West for Johnathan Hinks, James Campbell, Achilald Mc Campbell, Robert Ewing, James S. Foster and Wm. Parker Beginning at the western  $\frac{1}{2}$  mile post of said section Thence N  $85^{\circ}$  E 221 Poles & 19 links to the eastern  $\frac{1}{2}$  mile post of same. Then began at the Southern  $\frac{1}{2}$  m p Thence N  $6^{\circ}$  W 320 Poles 17 links to the Northern  $\frac{1}{2}$  mile post. Witness trees made at the center of said Section No 22 Sugar 10 inches in diameter S  $62^{\circ}$  W 44 links distant; Beech 20 inches in diameter N  $70^{\circ}$  E 10 links dist  
 Length of line East of center 162 Pole 3 lks  
 " " West " 159 " 16 "  
 " " South " 161 " 4  $\frac{1}{2}$  "  
 " " North " 159 " 12  $\frac{1}{2}$  "

Witness trees 79 Poles  $18\frac{1}{2}$  links north of center Beech 24 in diameter S  $41^{\circ}$  E  $3\frac{1}{2}$  links distant  
 Then ran the following lot of land Beginning 61 Poles  $4\frac{1}{2}$  links north of the Southern  $\frac{1}{2}$  mile post witness trees Sugar 15 inches in diameter N  $31^{\circ}$  E 5 links distant Thence N  $85^{\circ}$  E 81 Poles to a stone in open ground Thence S  $6^{\circ}$  E 61 Poles  $4\frac{1}{2}$  lks to a stone witness Beech 7 inches in diameter N  $16^{\circ}$  E  $11\frac{1}{2}$  lks distant Sugar 24 inches in diameter S  $82^{\circ}$  W 10  $\frac{1}{2}$  links distant Thence S  $85^{\circ}$  W 81 Poles to the beginning  
 Also ran at the same time the following lot of land Beginning 8 Poles and 7 lks west of the North E corner of the South West one fourth of the S W qr of Section No 22 S  $9^{\circ}$  R 1 W and running thence from the place of beginning S  $85^{\circ}$  W 58 Poles 7 lks to a stake then up the meanderings of little Bear blossom S  $63^{\circ}$  E 10 Poles 17 lks Thence S  $72^{\circ}$  E 42 Poles 12 links Thence N  $32\frac{1}{2}^{\circ}$  E